



Huawei Ascend P6-U06 Battery Replacement

Replace the Huawei Ascend P6-U06 battery.

Written By: Chase Hemming




INTRODUCTION

Replace your dying battery to bring the power back to your Phone.

TOOLS:


- [Phillips #000 Screwdriver](#) (1)
 - [iFixit Opening Tools](#) (1)
 - [Spudger](#) (1)
-

Step 1 — SIM Card

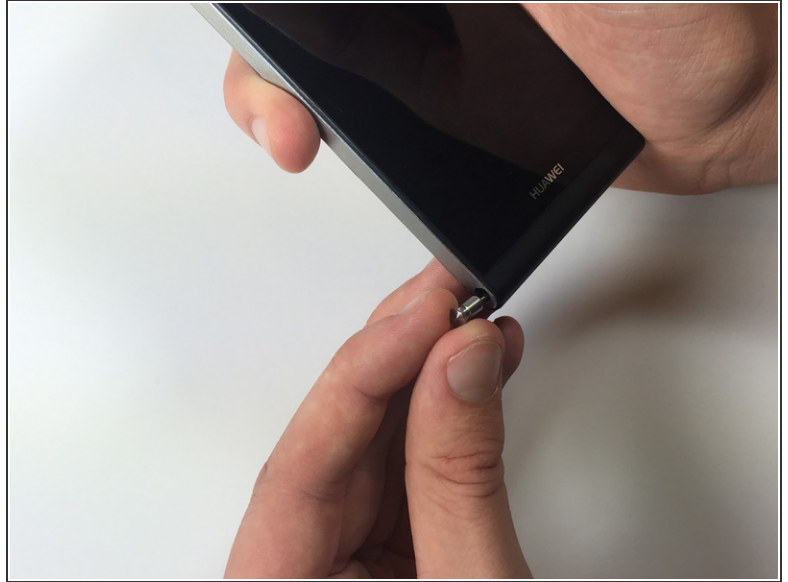

- Pull and twist the pin near the bottom left-side of the phone to remove it from the headphone jack.
- Huawei ascend p6

Step 2

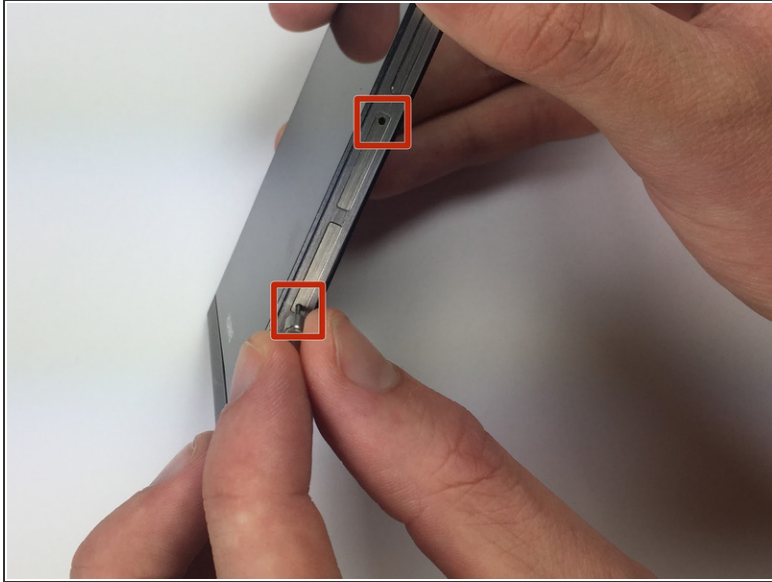


- Insert the pin into the SIM card opening located on the right-side of the phone.
- Gently push in until the SIM card clicks, and then pull the pin and SIM card out.
- Repeat this process for the additional SIM card.


Step 3 — Back Panel



- Firmly push down on the black plastic covering at the bottom of the phone, and pull down.

 You may need a sharp thin object to get underneath the plastic.

Step 4

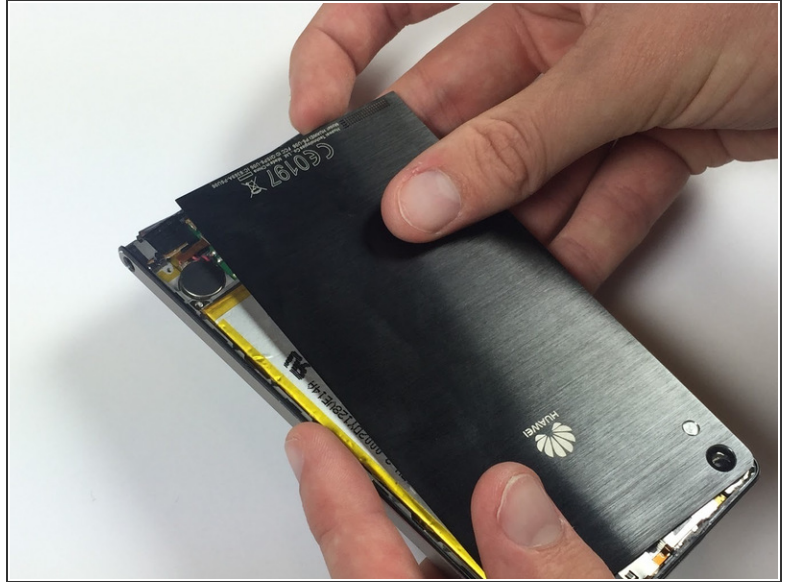

- Rotate the phone 180 degrees so that the bottom of the phone is now facing up.
- Firmly push up on the back panel with your thumbs.
- Lift up the back panel from the top right corner and gently pull it away from the phone.

Step 5 — Battery



- Remove the following screws securing the logic board to the main frame:
 - Five 2mm Phillips #000 screws
 - Two 2.5mm Phillips #000 screws

Step 6



- Push down the yellow plastic lining at the top of the battery and remove the two 2.5mm Phillips #000 screws.

Step 7




- Use the flat end of a spudger to gently snap open the first clip located on the the right arm of the retaining plate.
- Use the flat end of a spudger to gently snap the second clip located on the left arm of the retaining plate.
- Use the flat end of a spudger to gently lift the upper retaining plate from the phone.

Step 8




- Use the pointy end of a spudger to pry the antenna connector off of its socket.
- ☑ Upon reassembly, you will hear a "click" that indicates the pin has been properly reconnected.

Step 9

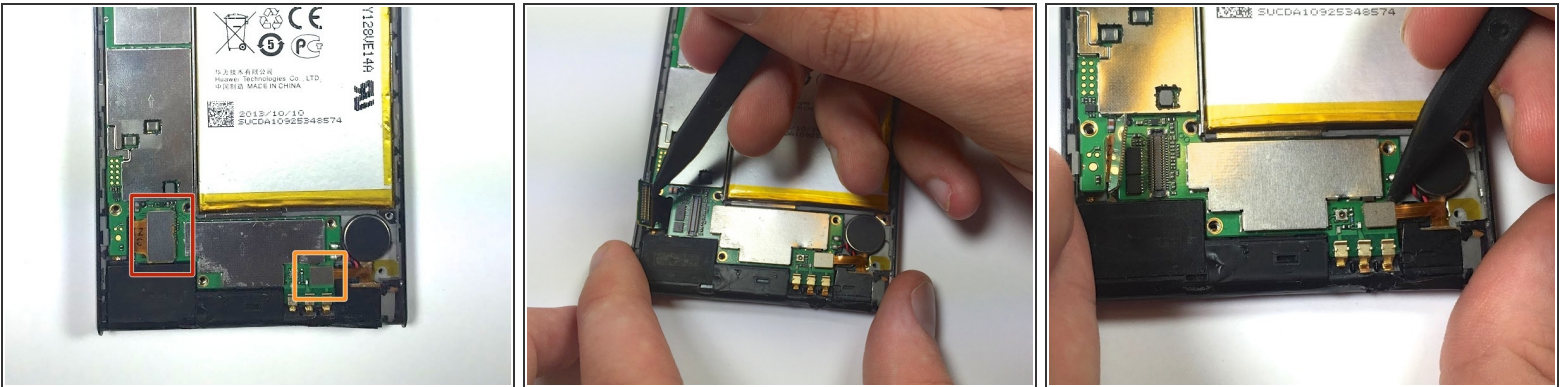


- Use the pointy end of a spudger to gently pry the following connectors out of their sockets:
 - silver LCD cable connector
 - silver Headphone jack cable connector

Step 10

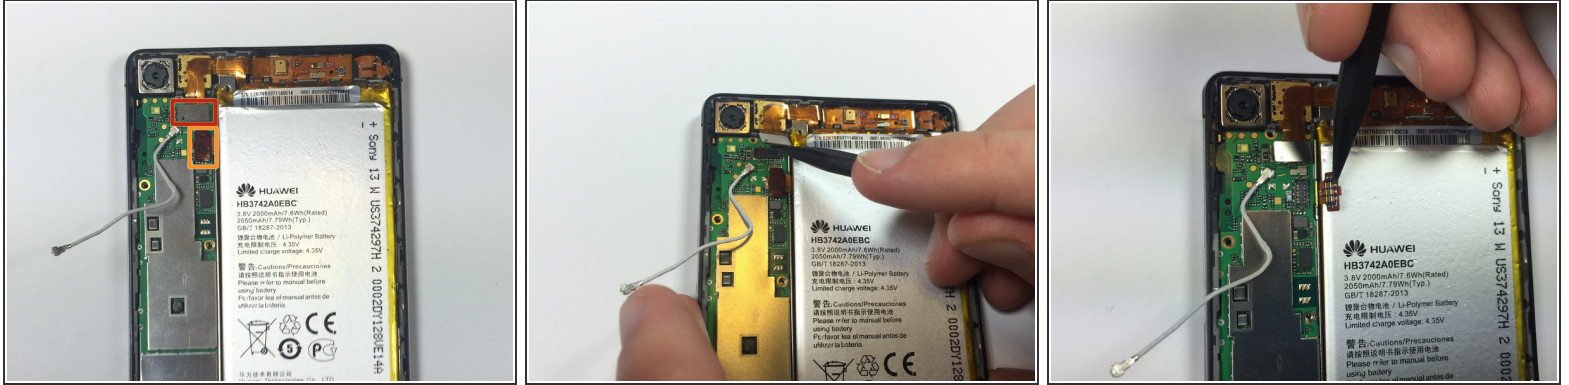

- Use the pointy end of a spudger to gently pry the following connectors out of their sockets.
 - Silver Micro-USB cable connector
 - Copper battery cable connector

Step 11

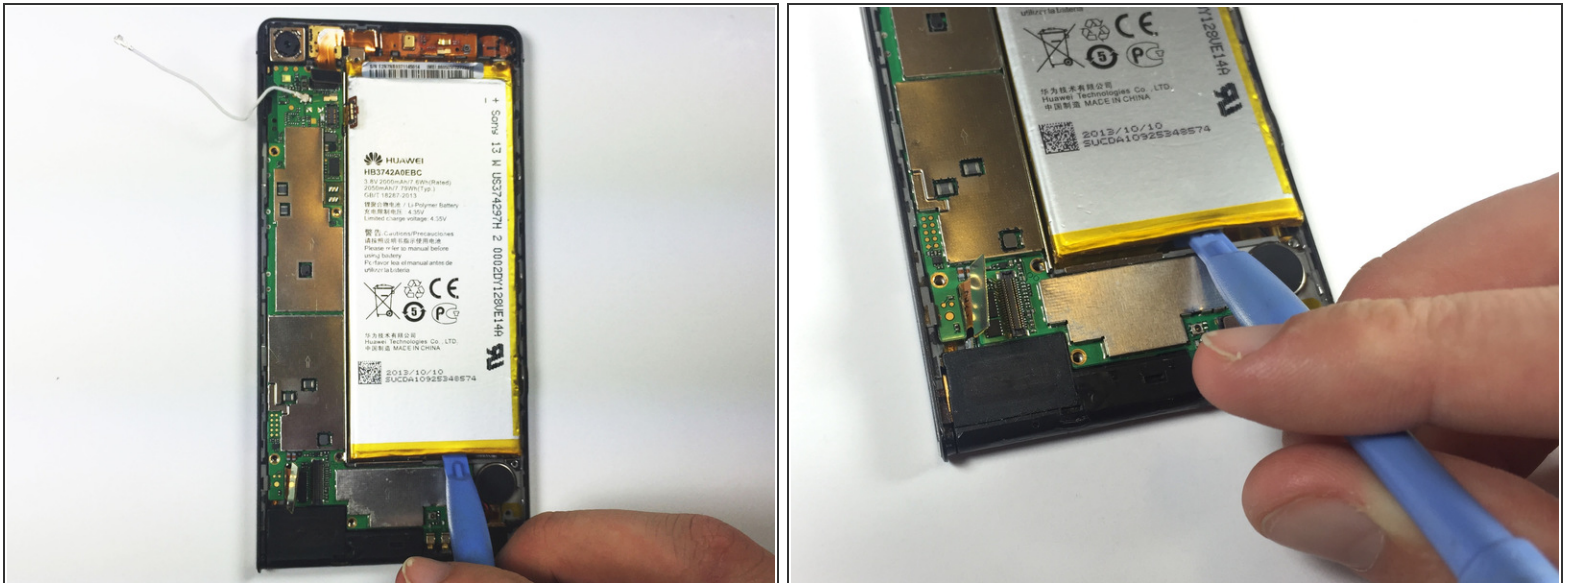

⚠ Be careful not to bend, puncture, or crush the battery, even if it is being replaced. The battery can potentially release toxic and flammable chemicals.

- Use a plastic opening tool to gently lift up the battery from the bottom end.
- (i)** You may need to loosen the adhesive under the battery with slow sawing motions.

To reassemble your device, follow these instructions in reverse order.

This document was last generated on 2017-11-15 12:34:17 AM.